

Classification:
Reference:
Date:

BT07-004

ITB07-006

February 20, 2007

2005 – 2006 G35 COUPE; TEAR IN DRIVER'S SEAT CUSHION TRIM

APPLIED VEHICLE: 2005 – 2006 G35 Coupe (CV35)

APPLIED VIN: Built before JNKCV54E(*)7M 901695

APPLIED DATE: Built before August 28, 2006

IF YOU CONFIRM

There is a cut or tear in the driver's seat cushion trim in the area shown in Figure 1.



Figure 1

ACTION

Replace the seat cushion trim. Refer to section SE in the Service Manual for replacement information.

- While the seat cushion trim is removed, use a file (or other suitable tool) to "round" the front edges of the finisher shown in Figure 2.

The sharp edges on the finisher may have caused the trim damage.

NOTE: See the "before" and "after" photos on the next page.

- Use 2 new clips when reinstalling the seat cushion outer finisher.

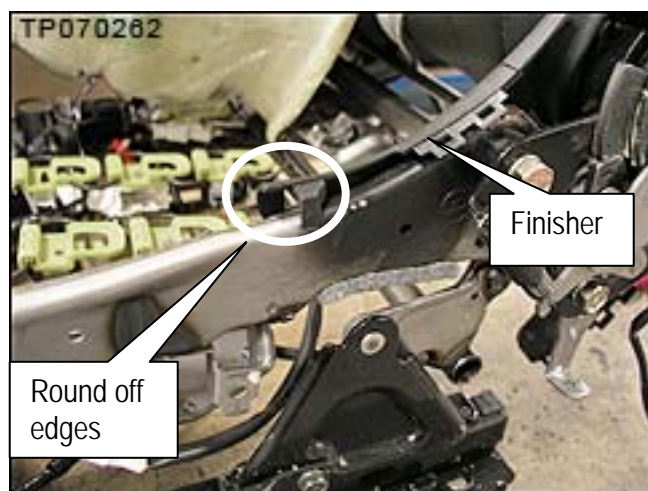


Figure 2

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

Before Rounding Edges

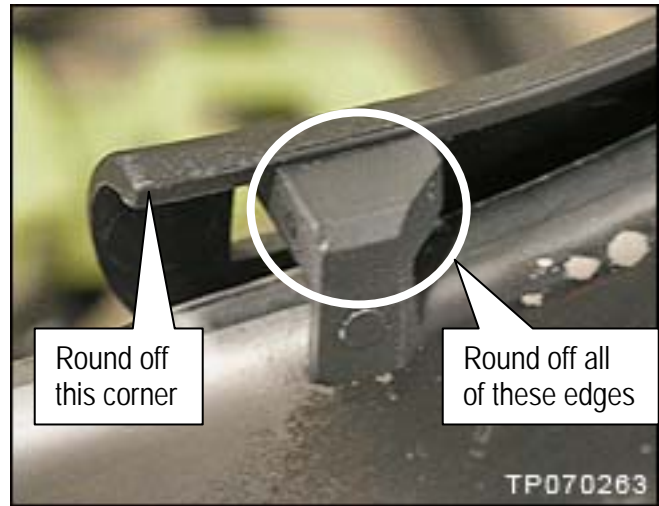


Figure 3

After Rounding Edges



Figure 4

PARTS INFORMATION

DESCRIPTION	PART NUMBER	Qty
Driver Side (Left Side) Seat Cushion Trim	Use the VIN and the electronic parts catalog (FAST or equivalent) to find the correct P/N	1
Clips (Seat Cushion Outer Finisher)	86901 – 2J020	2

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Left Seat Cushion Trim	(1)	VH28AA	ZA	02	(2)

- (1) Reference the FAST Parts Catalog and use the applicable Seat Cushion Trim P/N as the PFP.
 (2) Reference the current Infiniti Flat Rate Manual and use the indicated FRT.