



# SERVICE BULLETIN

Classification:

EL04-024

Reference:

NTB04-089

Date:

July 29, 2004

## WINDOW REGULATOR MOTOR RESET PROCEDURE

**APPLIED VEHICLE:** 2003-04 350Z (Z33)


### SERVICE INFORMATION

If any of the below work items were performed, the Window Regulator Motor must be reset. To reset the Motor, refer to the Service Procedure below.

- Removal and installation of the Window Regulator.
- Removal and installation of the Motor from the Window Regulator.
- Operating the Window Regulator outside of the vehicle.
- Removal and installation of the Window Glass.

### SERVICE PROCEDURE

1. Remove the Door Panel.
  - Refer to the applicable Service Manual for Door Panel removal instructions
2. With the door open, lift UP and HOLD the Window Switch until the Window is fully closed.
  - Do not use the Window auto-closing function
  - Do not release the Switch before the Window is fully closed
3. Get inside the vehicle and close the door.
  - You need to close the door so the Door Switch is fully depressed
4. Press and HOLD the Window Regulator Motor Reset Switch. While holding the Reset Switch, press DOWN and HOLD the Window Switch until the Window is fully opened.
  - Do not use the Window auto-opening function
  - Do not release the Switch before the Window is fully opened

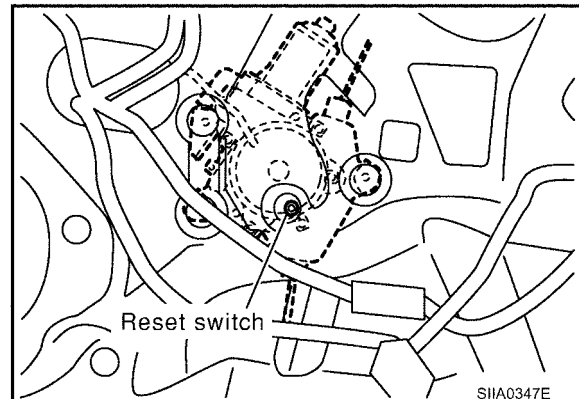

5. Release the Reset Switch. Then, lift UP and HOLD the Window Switch until the Window is fully closed.
  - Do not use the Window auto-closing function
  - Do not release the Switch before the Window is fully closed
6. Open the Door to release the Door Switch. The Window Glass should partially move down.
7. Re-install the Door Panel.

